

### Optional accessories

**07GZA000:** Scriber

**953638:** Holding bar for test indicator (length: 50 mm)

**900209:** Holding bar for test indicator (length: 100 mm)

**953639:** Holding bar for test indicator (length: 2 in)

**900306:** Holding bar for test indicator (length: 4 in)

**900321:** Swivel clamp used with holding bar (metric)

**900322:** Swivel clamp used with holding bar (inch)

**902053:** Clamp (with dovetail groove,  $\varnothing 6$  and  $\varnothing 8$  holes)

Note: A test indicator can be mounted on a height gage using a holding bar and clamp.

## Dial Height Gage SERIES 192 — With digital counter


- Easy and error-free reading with both up and down digital counters as well as a dial.

- Fits comfortably in the hand and moves easily on the surface plate.



- Can be zero-set at any arbitrary position.
- Provided with a large adjustment wheel for easy height adjustment.
- Clamp can be operated easily and securely.

- Carbide tipped scriber (**07GZA000**) is attached as standard. (Standard accessory: Scriber clamp **05GZA033**)
- For precision Black Granite Surface Plates, refer to page E-49.

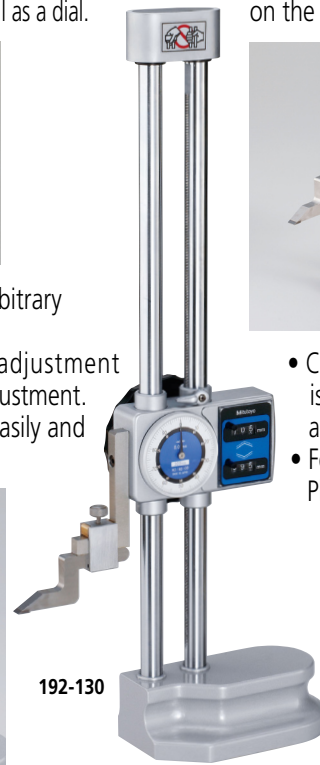

192-130

### SPECIFICATIONS

Metric					
Order No.	Range	Accuracy	Graduation	Height	Mass
192-130	0 - 300 mm	$\pm 0.03$ mm	0.01 mm	470 mm	4.2 kg
192-131	0 - 450 mm	$\pm 0.05$ mm		648 mm	9.2 kg
192-132	0 - 600 mm			798 mm	9.8 kg
192-133	0 - 1000 mm	$\pm 0.07$ mm		1220 mm	17.0 kg
Inch					
Order No.	Range	Accuracy	Graduation	Height	Mass
192-150	0 - 12 in	$\pm 0.0015$ in	0.001 in	470 mm	4.2 kg
192-151	0 - 18 in	$\pm 0.002$ in		648 mm	9.2 kg
192-152	0 - 24 in			798 mm	9.8 kg
192-153	0 - 40 in	$\pm 0.003$ in		1220 mm	17.0 kg

### DIMENSIONS

