

Order Code	Description
DPMD1	PosiTector Standard with DPM D Probe
DPMD3	PosiTector Advanced with DPM D Probe

PosiTector DPM Dew Point Meter	Compare PosiT	ector Gage Bodies
Features	Standard	Advanced
NEW Larger 2.8" impact resistant color touchscreen with redesigned keypad for quick menu navigation	•	•
Auto Log mode runs unattended on batteries for up to 50 hours or continuously via USB	•	
Enhanced Auto Log mode turns the gage off between readings for up to 8 months of battery life. Each reading can be uploaded to PosiSoft.net or an FTP server using WiFi. Automatically group readings into batches at daily, weekly, or monthly intervals.		•
Two year warranty on body AND probe	•	•
User defined limits for all parameters—visible and audible warnings. Send email alerts when connected to WiFi.		•
Reading Storage Capacity	2,500 datasets	250,000 datasets in up to 1,000 batches
NEW Touchscreen keyboard for quickly renaming batches, adding notes, and more		•
Store thickness, profile, environmental, salt contamination, hardness, and wall thickness measurements in individual batches		•
Wet bulb temperature can be displayed and recorded		•
Trend Charts graph readings in real-time		•
Connection Options		
USB port for fast, simple connection to a PC and to supply continuous power. USB cable included.	●	•
WiFi technology wirelessly synchronizes with PosiSoft.net and downloads software updates		•
Bluetooth 4.0 Technology for data transfer to a mobile device running the PosiTector App or optional portable printer. BLE API available for integration into third-party software.		•



Removeable Cabled Probe with 1/2" NPT Threads	Probe Model DP	Probe Model DPM D	
	Surface Temperature	-	
	Air Temperature	\checkmark	
T	Wet Bult Temperature	\checkmark	
	Relative Temperature	\checkmark	
URA D	Dew Point Temperature	\checkmark	
	Surface Temperature minus Dew Point Temperature	-	
	Wind Speed	-	

DPM D Probe measures dew point, RH and air temperature.

- 1/2" NPT threads for insertion into tanks and pipes (max 0.69 MPa/100 psi)
- · Sintered aluminum housing protects sensors

©DeFelsko Corporation USA 2022. All Rights Reserved. Technical Data subject to change without notice. • PDPM.v.LW/W2208



DeFelsko Corporation 800 Proctor Ave., Ogdensburg, New York 13669-2205 USA **Toll Free 1-800-448-3835 •** Tel: +1-315-393-4450 techsale@defelsko.com • www.defelsko.com





All Gages Feature...

Simple

- · All readings are constantly updated and displayed simultaneously
- · No need to consult complex tables or use a slide rule calculator
- Alarms indicate when climate conditions are unsuitable for painting
- **NEW** Larger 2.8" impact resistant color touchscreen with redesigned keypad for quick menu navigation
- NEW On-gage help explains menu items at the touch of a button
- RESET feature instantly restores factory settings

Durable

- NEW Weatherproof, dustproof, and water-resistant-IP65-rated enclosure
- NEW Ergonomic design with durable rubberized grip
- · Shock-absorbing protective rubber holster for added impact resistance
- Two year warranty on gage body AND probe

Accurate

- · Fast response precision sensors provide accurate, repeatable readings
- SmartTrend[™] Indicators identify rising, falling, or stable readings
- · Certificate of Calibration showing traceability to NIST included (Long Form)
- · Conforms to national and international standards including ISO and ASTM

Versatile

- Auto Log mode records environmental parameters at user selected time intervals
- Celsius/Fahrenheit switchable
- Selectable display languages
- NEW Auto rotating display with Flip Lock



Order Code	Description
DPMD1	PosiTector Standard with DPM D Probe
DPMD3	PosiTector Advanced with DPM D Probe



Powerful

- Hold function freezes the display allowing measurements to be manually recorded
- Screen Capture—save 100 screen images for record keeping and review
- NEW Instant-on feature quickly powers up the gage if recently powered down
- NEW Up to 30% longer battery life
- USB port for fast, simple connection to a PC and to supply continuous power. USB cable included.
- Software updates via web keep your gage current
- · Every stored measurement is date and time stamped
- Includes PosiSoft suite of software for viewing and reporting data (see page 3)

Specifications	Range	Accuracy	Resolution	
	-40° to 80° C	± 0.5° C	0.1° C	
Surface Temperature	80° to 190° C	± 1.5° C	0.1 0	
	-40° to 175° F	± 1° F	0.1° F	
	175° to 375° F	± 3° F		
Air	–40° to 80° C	± 0.5° C	0.1° C	
Temperature	-40° to 175° F	± 1° F	0.1° F	
Humidity	0 to 100%	± 3%	0.1%	
Dow Point	–60° to 80°C	± 3° C*	0.1° C	
Dew Point	-76° to 175° F	± 5.4° F*	0.1° F	

*Dependent on RH. See <u>www.defelsko.com/TdAccuracy</u> for more information.

Award Winning Compatibility!

SST

Т



PosiTector body accepts all PosiTector *DPM, 6000, 200, IRT, RTR, SPG, SST, SHD, BHI,* and *UTG* probes easily converting from a coating thickness gage to a dew point meter, surface profile gage, soluble salt tester, hardness tester, or ultrasonic wall thickness gage.

Comes complete with PosiTector gage body, DPM probe, environmental sensors, protective rubber holster, wrist strap, 3 AAA batteries, instructions, nylon carrying case with shoulder strap (DPM/DPMA/DPMD), hard shell carrying case (DPMS), protective lens shield, Long Form Certificate of Calibration traceable to NIST, USB cable, two (2) year warranty.

*SIZE: 127 x 66 x 25.4 mm (5" x 2.6" x 1")

*WEIGHT: 137 g (4.9 oz.) without batteries

CONFORMS TO: ISO 8502-4, BS 7079-B4, ASTM D3276, IMO PSPC, SSPC-PA7, and US Navy NSI 009-32 *Size and weight are for the PosiTector gage body only and do not include the probe.

©DeFelsko Corporation USA 2022. All Rights Reserved. Technical Data subject to change without notice. • PDPM.v.LW/W2208



DeFelsko Corporation 800 Proctor Ave., Ogdensburg, New York 13669-2205 USA Toll Free 1-800-448-3835 • Tel: +1-315-393-4450 techsale@defelsko.com • www.defelsko.com



PosiSoft[®] Suite of Software

Powerful ways to view and report your PosiTector and PosiTest data

PosiSoft Desktop — PC/Mac

Powerful desktop software for downloading, archiving, and reporting measurement data.

- Import readings directly from the gage via USB, WiFi, or legacy PosiSoft **Desktop versions**
- Jobs feature consolidates batches into groups to keep measurement data organized and to quickly create multi-batch reports


Panelinite	a test tables the						-
and the second second		Will have					
			02 10	CC			
			OF DI	C C	harn's star in	- 8 C	
				LIS812 - M			ABC
					was impection Re		
In Address of the second			4 B MANARAM				
							2010-00-02
						5 5	
						0 2	15.96
	Marrie .						
		2 2 2					
						2 5	
						6 8	122.4
			A 7 251-5334				
	100000	and an and an and an and an and an and an	· · · · · · · · · · · · · · · · · · ·				
						8 8	
						D 41	15.9.4
		Painting Company					
						8 6	
						3 6	184840
				Terrer Farm			
				Peakings			
		President A sublimate					
			4 × 20100.01				
				1			
			and .				

ABC

- Fully integrates with PosiSoft.net backup and synchronize jobs, batches, readings, and report templates to the cloud (see inset at right)
- Export readings as .csv (comma separated value) files for easy import into Excel and other spreadsheets

Professional. Custom Reports

- Compile single or multi-batch reports from multiple probes and instrument types
- Add pictures, screen captures, notes, and more with an onscreen live preview
- Instantly create professional reports from pre-formatted report templates
- Design custom layouts and templates—add custom cover pages and logos, and choose to display charts, histograms, and/or individual readings
- Drag-and-drop Custom Fields mode-import PDF forms and overlay fields to automatically populate inspection data

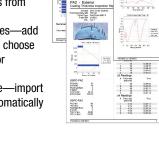

Prompted Batch Mode

Create pre-defined batches with onscreen text and image prompts for each reading and upload to PosiTector 6000, 200, and UTG gages (Advanced models only).

 Ideal for ensuring a consistent measurement pattern for repetitive jobs or when specific measurement locations are required

PosiSoft USB Drive — Gage based



A simple gage interface to retrieve data in a manner similar to USB flash drives or cameras. No software to install or internet connection required. Measurement data can be printed quickly from a formatted HTML report or exported in .csv format for further analysis in spreadsheets.

PosiTector Developer Resources

Bluetooth 4.0

•Keyboard Mode USB Serial PosiTector and PosiTest AT-A instruments can integrate with thirdparty software, drones, ROVs, PLCs, and robotic devices using several industry-standard communication protocols including: Bluetooth 4.0, WiFi, Keyboard mode, and USB serial.



©DeFelsko Corporation USA 2021. All Rights Reserved. Technical Data subject to change without notice. • Printed in USA • PSoft.v.LW/W2110



•WiFi

DeFelsko Corporation • 800 Proctor Ave. • Oadensburg, New York 13669-2205 USA Toll Free 1-800-448-3835 • Tel: +1-315-393-4450 techsale@defelsko.com • www.defelsko.com

PosiTector App — iOS/Android

Fully-featured mobile app that connects to the PosiTector SmartLink. PosiTector Advanced gages, and the PosiTest AT-A.

- Auto pairing Bluetooth BLE connection
- Add images and notes to individual readings or batches directly from your device
- Email readings as .csv (comma separated value) files for easy import to Excel and other spreadsheets.
- Synchronize readings with PosiSoft.netbackup and synchronize jobs, batches, and readings to the cloud (see inset below)

Mobile Reporting Solution

- Compile single or multi-batch reports from multiple probes and instrument types
- Add pictures, screen captures, notes, and more
- Email pre-formatted or custom reports from your device instantly





PosiSoft.net

Secure storage of measurement data in the cloud.

compatible with PosiSoft Desktop and PosiTector App

- Upload measurement data directly from WiFi-connected PosiTector Advanced gages from anywhere in the world-no software required
- Synchronize and share measurement data across multiple computers Ideal for...
 - Users with multiple computers, instruments, and office locations
 - Inspection companies managing data from multiple inspectors
- Login from PosiSoft Desktop to synchronize all measurement data and stored report templates from your account

PosiSoft.net					eFels	
Hello, morthrop@defelsko.com.						Log ou
Account Settings		My Jo	bs & Batches			
Set Language	Name	Probe ¥	Date	Probe S/N	Gage S/N	Report
Change password	Batches not linked to a Job					
Change email	800 Commerce Park		2021-07-23			PDF
Delete batches	Environmental Readings	DPM	2021-07-23 08:07:33	294613	871404	PDF
My Gages	Epoxy Top Coat	200-B	2021-07-16 11:07:02	295084	113211	PDF
Type S/N		P	age 1 of 1			
Delete batches My Gages Type S/N PosiTector Advanced 113211 PosiTector Advanced 871404	PKS 2021		2021-04-06			PDF
PosiTector Advanced 871404	US812-DPW		2021-04-01			PDF
Register Gage	BN0(2301		2020-08-04			PDF
Serial Number	🗃 😐 CX85		2020-08-04			PDF
Gage Key	💼 🖿 MOCPro		2020-08-04			PDF
Register Gage	-					

PosiSoft.net Web Viewer Review measurement data and print simple, pre-formatted PDF reports from any web browser-no software installation required.

